## **Authorised Distributors:-**

#### **ASH & ALAIN INDIA PVT LTD**

S-100, F.I.E.E., Okhla Industrial Area, Phase-ii, New Delhi-110020(India) Tel: 011-43797575 Fax: 011-43797574 E-mail: sales@ashalain.com

**Digital Pressure Sensor** 

# **E8F2**

# Pressure Sensor with Easy-to-Read LED Display

- Pressure status can be checked at a glance from the red digital pressure value and analog bar displays.
- Measurement pressure is averaged by the chattering prevention function to prevent incorrect outputs due to momentary pressure! changes.
- The automatic teaching function teaches pressure values for good and bad products.
- Industry's smallest models at just 28  $\times$  28  $\times$  29 mm.





Sensors

Sensing Guide

Pressure Sensors

Other Information

\_ . . . . . . .

on page 1119.

Be sure to read Safety Precautions

## Ordering Information

#### Sensors

Pressure range		ON/OFF output	Linear output	Model	
				NPN output	PNP output
Positive pressure	0 to 100 kPa	NPN open collector (two independent outputs)	1 to 5 V	E8F2-A01C	E8F2-A01B
	0 to 1 MPa			E8F2-B10C	E8F2-B10B
Negative pressure	0 to -101 kPa	(two macpenaem outputs)		E8F2-AN0C	E8F2-AN0B

#### Accessories (Order Separately)

Appearance	Name	Model	Remarks
	Mounting Bracket	E89-F3	Provided with the E8F2.
	Panel-mounting Bracket	E89-F4	Spacer provided.

E8Y- @-F@

1114

# **Ratings and Specifications**

#### Sensor

	NPN output	E8F2-A01C	E8F2-B10C	E8F2-AN0C		
Item	Model . PNP output	E8F2-A01B	E8F2-B10B	E8F2-AN0B		
<u>'</u>		12 to 24 VDC±10% with a ripple (p-p) of 10% max.				
Current consumption		70 mA max. *1	• • • • • • • • • • • • • • • • • • • •			
Pressure type		Gauge pressure				
Rated pres	ssure range	0 to 100 kPa	0 to 1 MPa	0 to -101 kPa		
Pressure :	setting range	0 to 100 kPa	0 to 1 MPa	0 to -101 kPa		
Withstand	pressure	400 kPa	1.5 MPa	400 kPa		
Applicable	e fluid	Non-corrosive gas and non-flamma	able gas			
Operating	mode	Hysteresis mode, window mode, a	nd automatic teaching mode			
Repeat ac		±1%FS max.				
Linearity (	linear output)	±1%FS max.				
Response	time (ON/OFF output)	5 ms max.				
Linear out	put	1 to 5 V with an output impedance	of 1 $k\Omega$ and a permissible resistive	load of 500 kΩ.		
ON/OFF o	utputs	NO or NC open collector (depending	ng on whether the output configurat	ion is NPN or PNP)		
Load	d current	30 mA max.				
Outp	out applied voltage	30 VDC max.				
Resi	dual voltage	NPN open collector output: 1 V max. with 30 mA load current PNP open collector output: 2 V max. with 30 mA load current				
Display *2	:	3.5-digit red LED Green LED bar indicator The orange LED is lit for two independent outputs with output transistor turned ON. Green unit indicator				
Display ac	ccuracy	±3%FS±1 digit max.				
Protection	circuits	Reverse polarity protection, load short-circuit protection				
Ambient to	emperature	Operating: 0 to 55°C Storage: -10 to 60°C (with no icing)				
Ambient h	umidity	Operating/Storage: 35% to 85% (with no condensation)				
Temperati	ure influence	±3%FS max.				
/oltage in	fluence	±1.5%FS max.				
nsulation	resistance	100 MΩ min. (at 500 VDC) between current-carrying parts and case				
Dielectric	strength	1,000 VAC at 1 min				
Vibration resistance		Destruction: 10 to 500 Hz, 1.0-mm double amplitude or 150 m/s², three times each for 11 min in the X, Y, and Z directions				
Shock resistance		Destruction: 300 m/s² 3 times each in the X, Y, and Z directions				
Degree of protection		IP50 (IEC)				
Pressure	port	R (PT) 1/8 taper screw and M5 female screw				
Connection method		Pre-wired (standard length: 2 m)				
Cable		Approved by UL				
Weight (packed state)		Approx. 110 g				
Matarial	Pressure port	Aluminum die-cast				
Material Case		Heat-resistive ABS				
Accessories		Mounting Bracket, Instruction manual				

<sup>\*1.</sup> The current consumption is approximately 43 mA in energy-saving mode. \*2. Display Example of Digital Indicator

	Setting unit kPa				
Model					
	Applied pressure	Digital display			
E8F2-A01C	100	1	0	0 (	0
E8F2-B10C	1000	1	0	0	0
E8F2-AN0C	-101	-1	0	1 0	0

Note: The period (•) in the display indicates the decimal point. Its position will not change unless the setting unit is changed.

Sensing Guide

Pressure Sensors

Other Information


> E8F2 E8MS /E8M

E8Y

E8Y-□-F□


# **Engineering Data (Typical)**

# Temperature vs. Linear Output Current Temperature vs. Operating Pressure Fluctuation Fluctuation

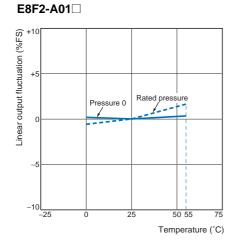

60

Pressure (kPa)

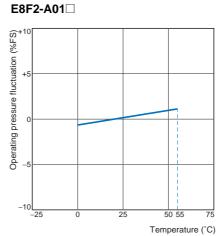

#### Pressure vs. Linear Output

### **E8F2-A01**□

# (V) and the content of the content o

#### Pressure Sensors


Sensing Guide Pressure

Sensors

Other Information

#### Linearity

#### E8F2-A01□

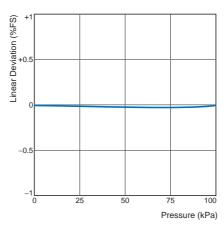

# I/O Circuit Diagrams

#### **NPN Output**

Oper-	Model	Timing chart		Output sinsuit	
ating mode		Hysteresis mode	Window mode	Output circuit	
NO	E8F2-A01C	Pressure ON point OFF point  Output ON OFF OUT Indicator ON (orange) OFF	OFF point ON point OUT OFF OUT Indicator ON OFF ON	Brown +12 to 24 V  Load 30 mA  Black Load max.	
NC	E8F2-B10C E8F2-AN0C	Pressure ON point OFF point  Output ON OUT OFF OUT Indicator (orange) OFF	OFF point ON Output ON OUT OFF ON (orange) OFF	Pressure White (ON/OFF2) Gray 1 to 5 V (linear) Load  Blue 0 V	

#### **PNP Output**

Oper-		Timing chart			
ating mode	Model	Hysteresis mode	Window mode	Output circuit	
NO	E8F2-A01B	Pressure ON point OFF point  Output ON OFF UT indicator (orange) OFF	Pressure  OFF point  ON po	Pressure sensor main circuit White (ON/OFF2)	
NC	E8F2-B10B E8F2-AN0B	Pressure ON point OFF point  Output ON OUT OFF OUT Indicator ON (orange) OFF	Pressure OFF point ON	Gray 1 to 5 V 30 mA max.  I(Linear) Load Load Load max.  Blue 0 V	

Pressure Sensors

Sensing Guide


Pressure Sensors

Other Information

> E8F2 E8MS /E8M

E8Y- - F

#### **Nomenclature**

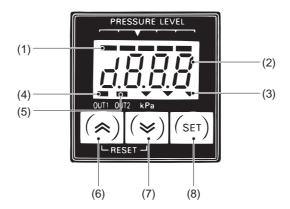

#### **Display Panel**

(1) Bar Indicator (Green)

Indicates the degree of measured pressure in relation to the set pressure.

(2) Numeric and Menu Display (Red)

Indicates measurement values and setting menu items.

(3) Unit indicator (Green)

Indicates the unit used for detection. The unit indicated on the indicator is the one currently set.

(4) OUT1 Indicator (Orange)

Lit when OUT1 is turned ON.

(5) OUT2 Indicator (Orange)

Lit when OUT2 is turned ON.

Sensing Guide

Pressure Sensors

Pressure Sensors

Other Information

#### **Operation Keys**

(6) ⊗ Up Key, (7) ⊗ Down Key

- Used to select or change the set items, set contents, and set values in setting mode.
- Press either key to check the ON and OFF points in measurement mode. The values are reset by pressing both keys simultaneously.
- Use together with the SET Key for setting the Sensor to a special setting mode or energy-saving mode.

#### (7) SET Key

- Used for entering the set contents and set values in setting mode.
- Used for setting the Sensor to basic setting mode or pressure setting mode.

E8F2
E8MS
/E8M
E8Y

#### **Safety Precautions**

#### Refer to Warranty and Limitations of Liability on page F-2.

#### WARNING

This product is not designed or rated for ensuring safety of persons. Do not use it for such purpose.



#### **Precautions for Correct Use**

Do not use this product in atmospheres or environments that exceed product ratings.

#### Installation


Do not use the Sensor in an environment subject to corrosive or combustible gas.

#### Wiring

If no linear output is used, cut the gray lead wire short and apply insulating tape to the lead wire so that it will not come into contact with any other terminal.

#### Mounting

- Do not apply a tensile strength in excess of 50 N to the cables or connectors.
- The pressure port (made of aluminum die-cast) is fixed with tapered R(PT) 1/8 male screws and M5 female screws. When using tapered screws, use tapered Rc(PT) 1/8 female screws.
- Wrap the tapered R(PT) 1/8 male screws with sealing tape to prevent any leakage. Tighten the male screws to a torque of 10 N·m max.
- Tighten M5 female screws to a torque of 2 N·m max.
- Tighten each male screw by using a 12-mm wrench to hold its hexagonal head, not its body.

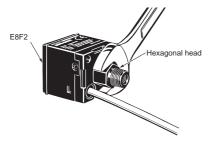

 When attaching the Mounting Bracket to the Sensor, make sure that each M3 screw is tightened to a torque of 0.5 N·m max.

#### Adjustments

- Filter the gas with an appropriate air filter so that the applied gas will be free of moisture or oil.
- Be sure to use the Sensor under the rated pressure.
- When setting the set pressure of the ON or OFF point of the output transistor by pressing the mode selection key, use a manometer if precise pressure settings are required. The Sensor has a display error of 3% FS±1 digit at room temperature. Refer to *Display* accuracy in *Ratings and Specifications*.
- Turning ON the power

The Sensor is ready to operate 0.5 s after it is turned ON. When the load and Sensor are connected to separate power supplies, be sure to turn ON the Sensor first.

#### Others

Make sure the Sensor does not get wet.

Pressure Sensors

Sensing Guide

Pressure Sensors

Other Information


E8F2

/E8M E8Y

E8Y-🗆-F

**Dimensions** (Unit: mm)

#### **Sensors**

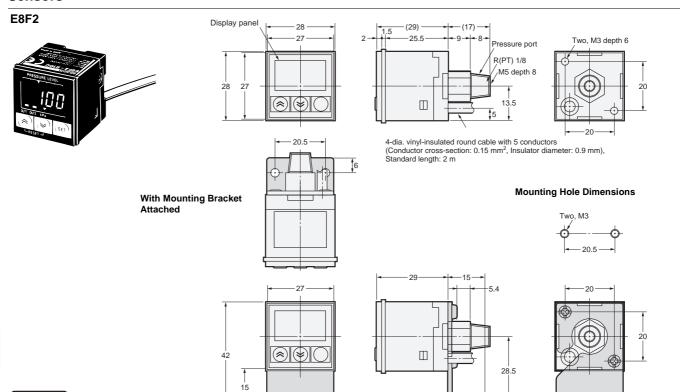

CAD data


Sensing Guide

Pressure Sensors


Other Information


**Accessories** 

**Mounting Bracket** E89-F3

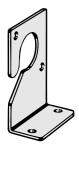

Note: Provided with the E8F2.

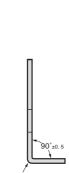

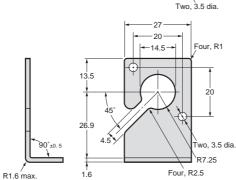

20.5


E8F2 E8MS /E8M E8Y E8Y-□-F□


#### Pane I-mounting Bracket E89-F4



Note: Spacer provided.

#### **Panel Cutout Dimensions**

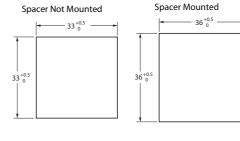

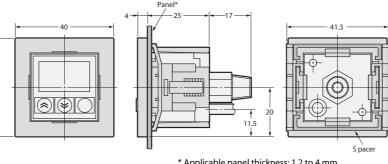

\* Applicable panel thickness: 1.2 to 4 mm

Note: The spacer can be removed from the Panel-mounting Bracket. The panel cutout dimensions can be adjusted as shown above by attaching or detaching the spacer.

Cat. No. F831-E1-01

In the interest of product improvement, specifications are subject to change without notice.

Pressure Sensors

Sensing Guide

Other Information



# **Authorised Distributors:-**

**ASH & ALAIN INDIA PVT LTD** 

S-100, F.I.E.E., Okhla Industrial Area, Phase-ii, New Delhi-110020(India) Tel: 011-43797575 Fax: 011-43797574 E-mail: sales@ashalain.com

E8MS /E8M E8Y

E8Y- @-F@